


Fault type	Condition for Fault	Observable Symptoms	Possible cause
P204B FTB 64	• Abnormal pressure.	• No AdBlue solution dosage.	• Hose. • Pressure sensor. • Nozzle.

Check that the dosing valve is free from cracks, cuts or café.

Check for pinched, restricted or damaged aftertreatment DEF line(s) that could cause poor DEF flow.

Voltage measurement:

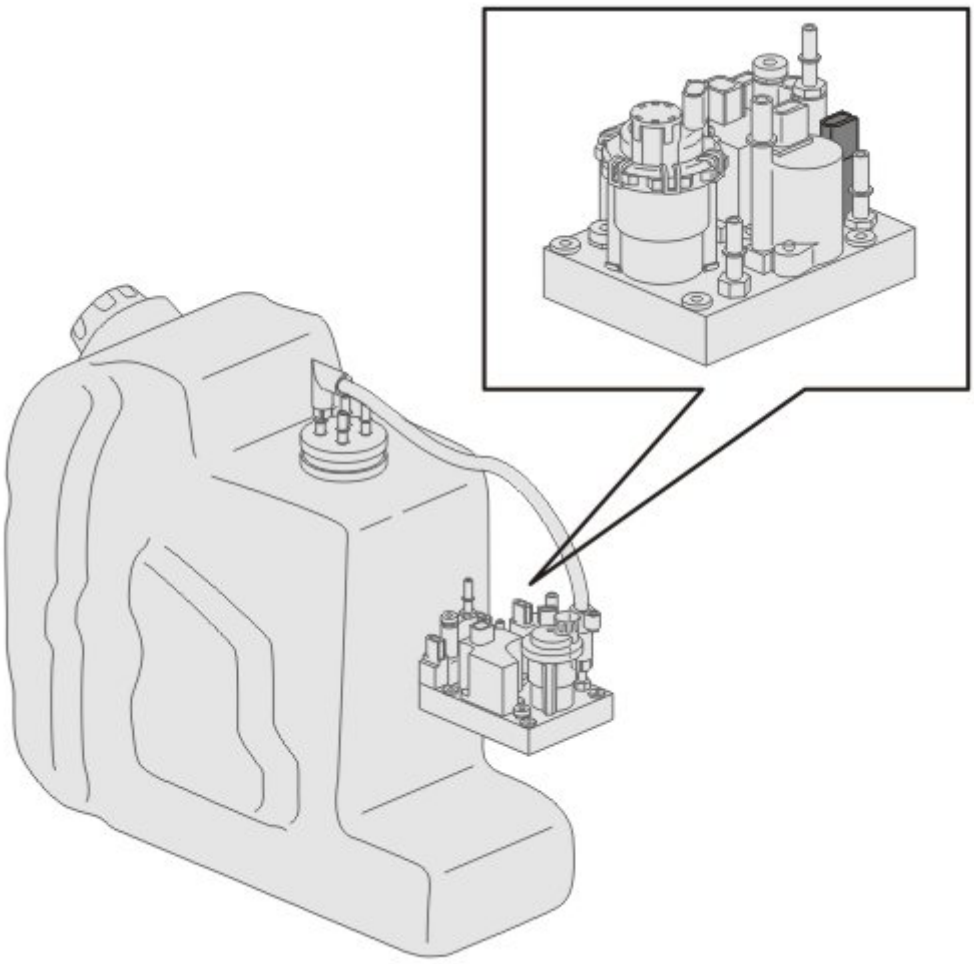

Measuring	Key position	Measurement points		Reference value	Measured value	Other (Special tool No.)
		Breakout box	Wiring diagram			
Supply Voltage check	On	47 – 49	B125:1 – B125:3	V = 4.75 V - 5.25 V		9998699, 88890167, 88890074
Voltage check	On	47 – Chassis ground point.	B125:1 – Chassis ground point.	V = 4.75 V - 5.25 V		9998699, 88890167, 88890074