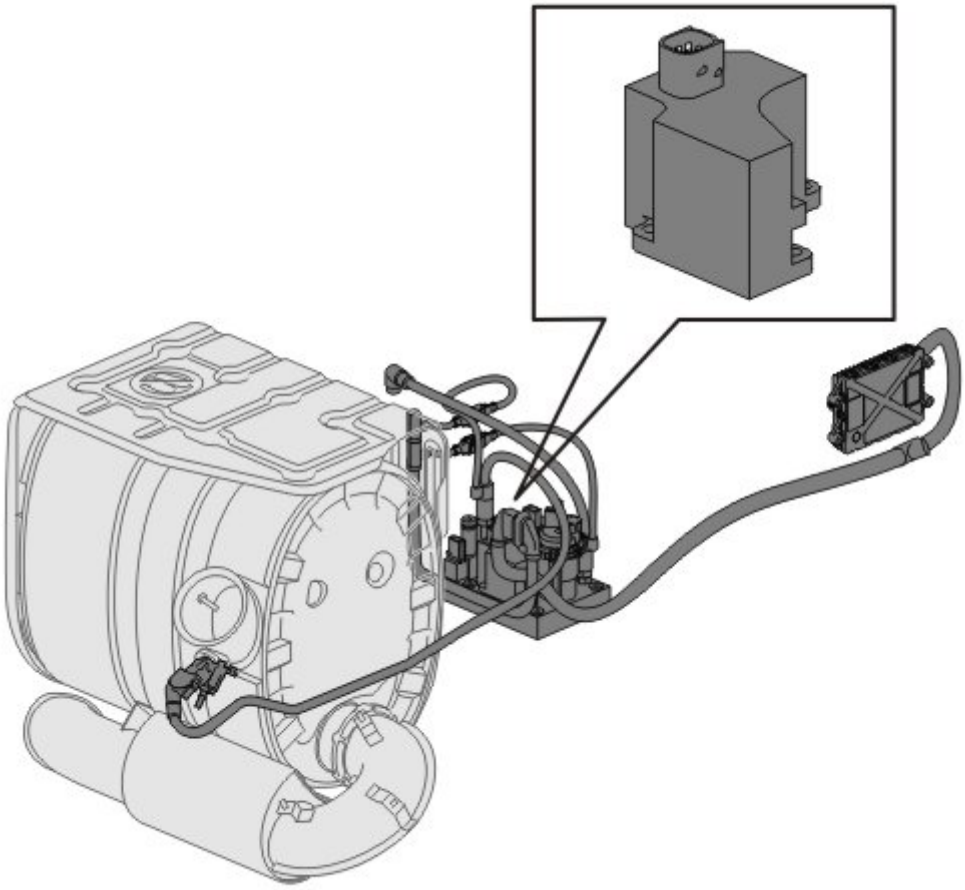


Fault type	Condition for Fault	Observable Symptoms	Possible cause
P2043 FTB 64	• Signal Plausibility Failure.	• None	• Reductant Temperature Sensor. • Wiring harness.

The tank may get too hot if a hot object is mounted too close.

Check the AdBlue tank temperature by using thermometer 9998519.